





This spreadsheet performs screening level calculations to estimate the effect of peeling leaded paint on the average concentration of lead in yard soil
3610 High Street


| INPUTS | | Units | House |
|-----------------------|---|--------|--------------|
| General | Variable | | |
| | Mixing depth in yard | cm | 2.54 |
| | Mixing depth in yard | inches | 1 |
| | Soil density | g/cm3 | 2.5 |
| | RBC in soil | mg/kg | 400 |
| House-specific | Bkg in clean fill | mg/kg | 50 |
| | | | Small |
| | Area of the exposure unit | m2 | 89.18692 |
| | Area of the exposure unit | ft2 | 960 |
| | Concentration of lead in paint | mg/cm2 | 30.4 |
| COMPUTATIONS | Area of peeling paint | m2 | 84.72757 |
| | Area of peeling paint | ft2 | 912 |
| DECISION | | | |
| | Mass of lead from paint | mg | 2.6E+07 |
| | Volume of soil | cm3 | 2.3E+06 |
| | Mass of soil | kg | 5.7E+03 |
| | Incremental concentration | mg/kg | 4548.0 |
| | Maximum acceptable area of peeling leaded paint (m2) | | 6.5 |
| | Maximum acceptable area of peeling leaded paint (ft2) | | 70.2 |
| DECISION | | | Not OK |

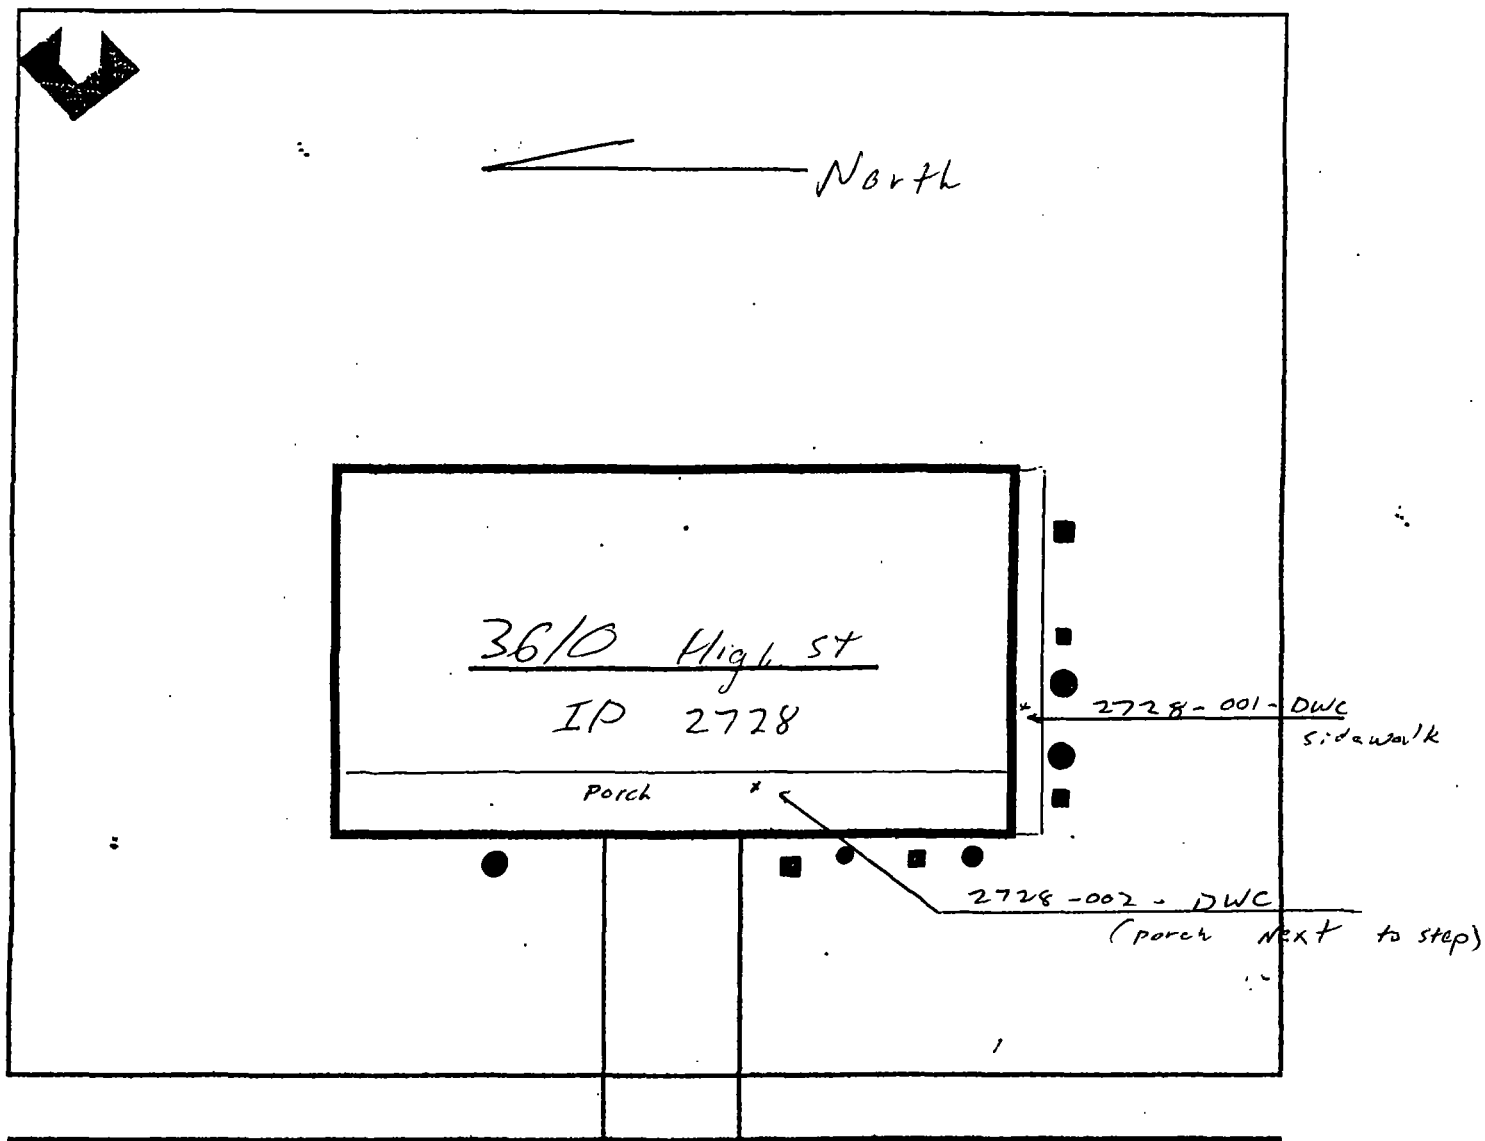

- | | | | | | | |
|----|----------|-----|---|------------|--------|-----------|
| 1) | 2728-001 | SCC | ● | 1600 hours | 6/8/06 | 1' offset |
| 2) | 2728-002 | SCC | ■ | 1605 hours | 6/8/06 | 1' offset |
| 3) | 2728-001 | DWC | | 1545 hours | 6/8/06 | |
| 4) | 2728-002 | DWC | | 1558 hours | 6/8/06 | |
| 5) | | | | | | |
| 6) | | | | | | |

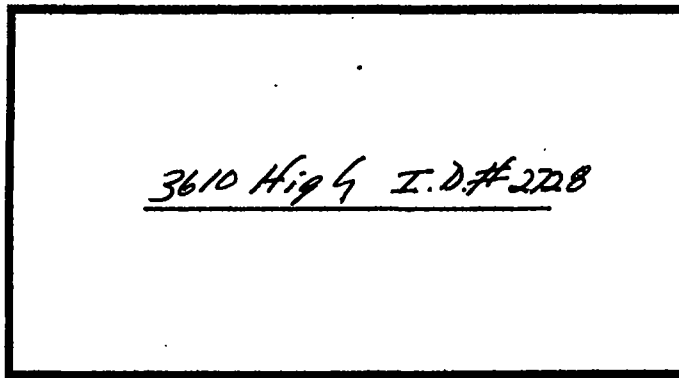

X 2728-0018-DWC
SIDEWALK

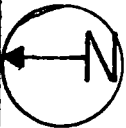

1) 2728-0018-DWC 0810 Hours 07-08-06

2)

3)

4)

5)

6)

3rd

Evergreen Analytical, Inc.

4036 Youngfield Street, Wheat Ridge, Colorado 80033-3862
(303) 425-6021

Client Sample ID: 2728-001B-DWC
Client Project ID: 213001.01
Date Collected: 7/6/06
Date Received: 7/8/06

Lab Work Order: 06-4292
Lab Sample ID: 06-4292-10
Sample Matrix: Wipe

METALS

Method: SW6010

Prep Method: SW6010

Date Prepared: 7/10/06
Date Analyzed: 7/12/06

Lab File ID: 071106PM
Method Blank: MB-10339

Dilution Factor: 1
Lab Fraction ID: 06-4292-10A

| Analytes | CAS Number | Result | LQL | Units |
|----------|------------|--------|-----|---------|
| Lead | 7439-92-1 | 4.9 | 4.0 | µg/WIPE |



Analyst



Approved

Qualifiers: B - Analyte detected in the associated Method Blank, value not subtracted from result
E - Extrapolated value. Value exceeds calibration range
H - Sample analysis exceeded analytical holding time
J - Indicates an estimated value when the compound is detected, but is below the LQL
S - Spike Recovery outside accepted limits
U - Compound analyzed for but not detected
X - See case narrative
* - Value exceeded the Maximum Contamination Level (MCL), TCLP limit, or if compound is undetected, LQL exceeds MCL.

Definitions: NA - Not Applicable
LQL - Lower Quantitation Limit
Surr - Surrogate

Print Date: 7/12/06

3rd

32
14

Evergreen Analytical, Inc.

4036 Youngfield Street, Wheat Ridge, Colorado 80033-3862
(303) 425-6021

Client Sample ID: 2728-002A-SCC
Client Project ID: 213001.01
Date Collected: 6/27/06
Date Received: 6/28/06

Lab Work Order: 06-4098
Lab Sample ID: 06-4098-02
Sample Matrix: Soil

METALS

Method: SW6010

Prep Method: SW3050

Date Prepared: 6/29/06
Date Analyzed: 6/30/06

Lab File ID: 063006PM
Method Blank: MB-10270

Dilution Factor: 1
Lab Fraction ID: 06-4098-02A

| Analytes | CAS Number | Result | LQL | Units |
|----------|------------|--------|-----|-------|
| Lead | 7439-92-1 | 25 | 5.7 | mg/Kg |


MB

Analyst


UBA

Approved

Qualifiers: B - Analyte detected in the associated Method Blank, value not subtracted from result
E - Extrapolated value. Value exceeds calibration range
H - Sample analysis exceeded analytical holding time
J - Indicates an estimated value when the compound is detected, but is below the LQL
S - Spike Recovery outside accepted limits
U - Compound analyzed for but not detected
X - See case narrative
* - Value exceeded the Maximum Contamination Level (MCL), TCLP limit, or if compound is undetected, LQL exceeds MCL.

Definitions: NA - Not Applicable
LQL - Lower Quantitation Limit
Surr - Surrogate

Print Date: 7/5/06

Evergreen Analytical, Inc.

4036 Youngfield Street, Wheat Ridge, Colorado 80033-3862

(303) 425-6021

Client Sample ID: 2728-001A-DWC

Client Project ID: 213001.01

Date Collected: 6/27/06

Date Received: 6/28/06

Lab Work Order: 06-4098

Lab Sample ID: 06-4098-03

Sample Matrix: Wipe

METALS

Method: SW6010

Prep Method: SW6010

Date Prepared: 6/30/06

Date Analyzed: 7/3/06

Lab File ID: 070306PM


Method Blank: MB-10272

Dilution Factor: 1

Lab Fraction ID: 06-4098-03A

| Analytes | CAS Number | Result | LQL | Units |
|----------|------------|--------|-----|---------|
| Lead | 7439-92-1 | 120 | 4.0 | µg/WIPE |


Analyst


Approved

Qualifiers: B - Analyte detected in the associated Method Blank, value not subtracted from result
E - Extrapolated value. Value exceeds calibration range
H - Sample analysis exceeded analytical holding time
J - Indicates an estimated value when the compound is detected, but is below the LQL
S - Spike Recovery outside accepted limits
U - Compound analyzed for but not detected
X - See case narrative
* - Value exceeded the Maximum Contamination Level (MCL), TCLP limit, or if compound is undetected, LQL exceeds MCL.

Definitions: NA - Not Applicable
LQL - Lower Quantitation Limit
Surr - Surrogate

Print Date: 7/5/06

Evergreen Analytical, Inc.

4036 Youngfield Street, Wheat Ridge, Colorado 80033-3862
(303) 425-6021

Client Sample ID: 2728-002A-DWC
Client Project ID: 213001.01
Date Collected: 6/27/06
Date Received: 6/28/06

Lab Work Order: 06-4098
Lab Sample ID: 06-4098-04
Sample Matrix: Wipe

METALS

Method: SW6010

Prep Method: SW6010

Date Prepared: 6/30/06
Date Analyzed: 7/3/06

Lab File ID: 070306PM
Method Blank: MB-10272

Dilution Factor: 1
Lab Fraction ID: 06-4098-04A

| Analytes | CAS Number | Result | LQL | Units |
|----------|------------|--------|-----|---------|
| Lead | 7439-92-1 | 5.7 | 4.0 | µg/WIPE |

MB

Analyst


WKB

Approved

Qualifiers: B - Analyte detected in the associated Method Blank, value not subtracted from result
E - Extrapolated value. Value exceeds calibration range
H - Sample analysis exceeded analytical holding time
J - Indicates an estimated value when the compound is detected, but is below the LQL
S - Spike Recovery outside accepted limits
U - Compound analyzed for but not detected
X - See case narrative
* - Value exceeded the Maximum Contamination Level (MCL), TCLP limit, or if compound is undetected, LQL exceeds MCL.

Definitions: NA - Not Applicable
LQL - Lower Quantitation Limit
Surr - Surrogate

Print Date: 7/5/06

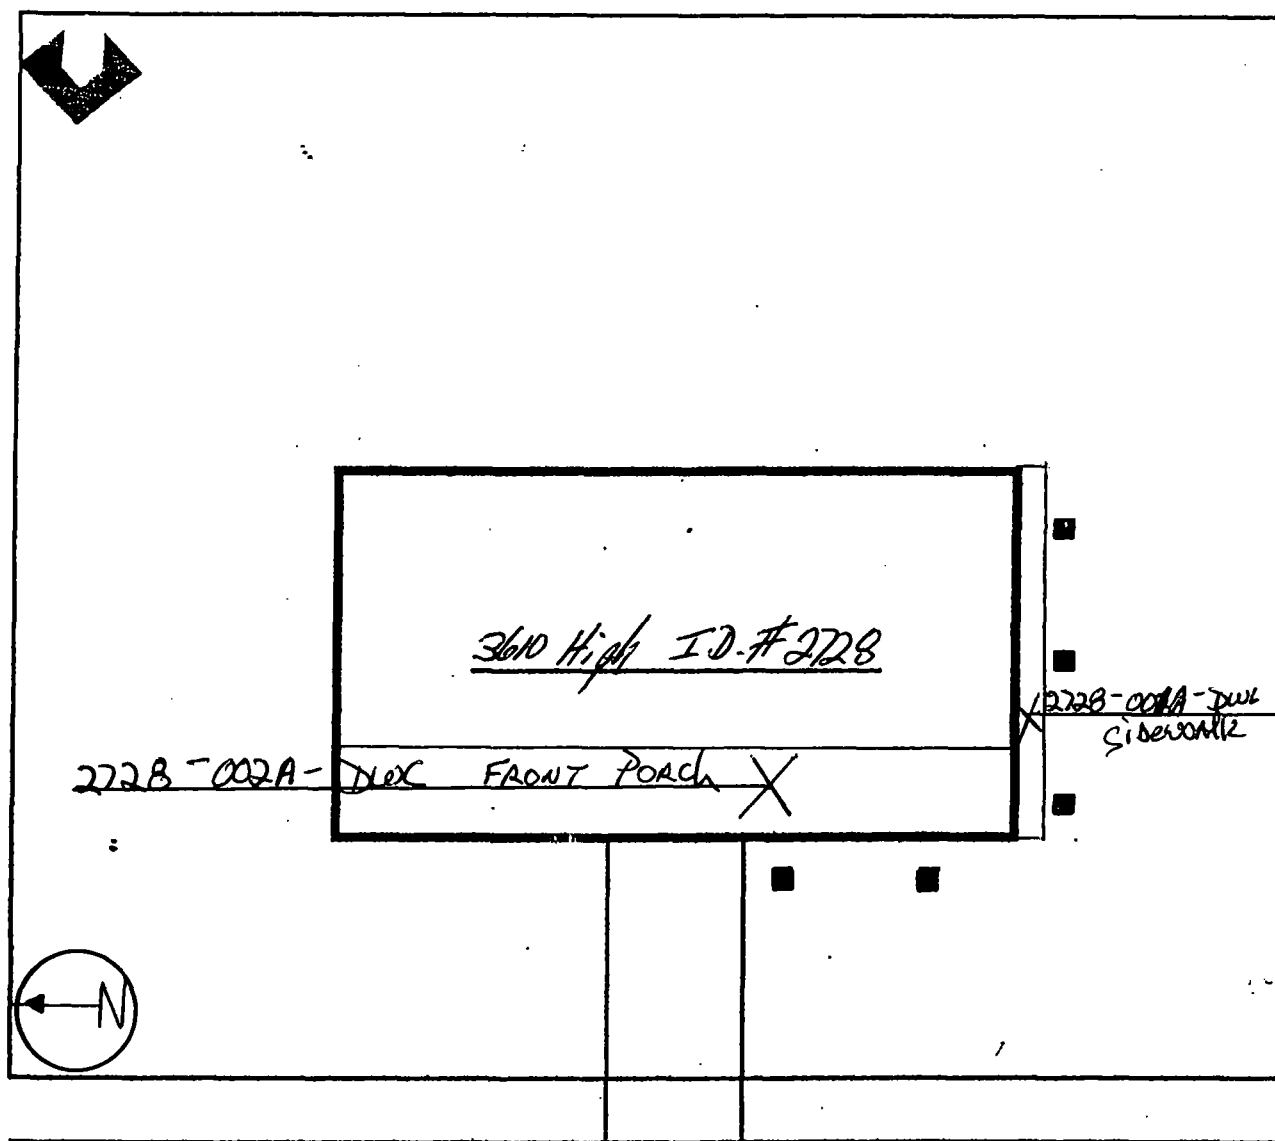

1) 2728-002A-SCC 10:10 HOURS ■ 06-27-06

2) 2728-001A-DWC 0950 HOURS 06-27-06

3) 2728-002A-DWC 1000 HOURS 06-27-06

4)

5)

6)

Evergreen Analytical, Inc.

4036 Youngfield Street, Wheat Ridge, Colorado 80033-3862
(303) 425-6021

Client Sample ID: 2728-001-SCC
Client Project ID: 213001.01
Date Collected: 6/8/06
Date Received: 6/8/06

Lab Work Order: 06-3650
Lab Sample ID: 06-3650-09
Sample Matrix: Soil

METALS

Method: SW6010

Prep Method: SW3050

Date Prepared: 6/12/06
Date Analyzed: 6/17/06

Lab File ID: 061606PM
Method Blank: MB-10126

Dilution Factor: 1
Lab Fraction ID: 06-3650-09A

| Analytes | CAS Number | Result | LQL | Units |
|----------|------------|--------|-----|-------|
| Lead | 7439-92-1 | 280 | 5.8 | mg/Kg |

MB

Analyst

WJH

Approved

Qualifiers: B - Analyte detected in the associated Method Blank, value not subtracted from result
E - Extrapolated value. Value exceeds calibration range
H - Sample analysis exceeded analytical holding time
J - Indicates an estimated value when the compound is detected, but is below the LQL
S - Spike Recovery outside accepted limits
U - Compound analyzed for but not detected
X - See case narrative
* - Value exceeded the Maximum Contamination Level (MCL), TCLP limit, or if compound is undetected, LQL exceeds MCL.

Definitions: NA - Not Applicable
LQL - Lower Quantitation Limit
Surr - Surrogate

Print Date: 6/19/06

Evergreen Analytical, Inc.

4036 Youngfield Street, Wheat Ridge, Colorado 80033-3862
(303) 425-6021

Client Sample ID: 2728-002-SCC
Client Project ID: 213001.01
Date Collected: 6/8/06
Date Received: 6/8/06

Lab Work Order: 06-3650
Lab Sample ID: 06-3650-10
Sample Matrix: Soil

METALS

Method: SW6010

Prep Method: SW3050

Date Prepared: 6/12/06
Date Analyzed: 6/17/06

Lab File ID: 061606PM
Method Blank: MB-10126

Dilution Factor: 1
Lab Fraction ID: 06-3650-10A

| Analytes | CAS Number | Result | LQL | Units |
|----------|------------|--------|-----|-------|
| Lead | 7439-92-1 | 900 | 5.8 | mg/Kg |

MB

Analyst

WHA

Approved

Qualifiers: B - Analyte detected in the associated Method Blank, value not subtracted from result
E - Extrapolated value. Value exceeds calibration range
H - Sample analysis exceeded analytical holding time
J - Indicates an estimated value when the compound is detected, but is below the LQL
S - Spike Recovery outside accepted limits
U - Compound analyzed for but not detected
X - See case narrative
* - Value exceeded the Maximum Contamination Level (MCL), TCLP limit, or if compound is undetected, LQL exceeds MCL.

Definitions: NA - Not Applicable
LQL - Lower Quantitation Limit
Surr - Surrogate

Print Date: 6/19/06

Evergreen Analytical, Inc.

4036 Youngfield Street, Wheat Ridge, Colorado 80033-3862
(303) 425-6021

Client Sample ID: 2728-001-DWC
Client Project ID: 213001.01
Date Collected: 6/8/06
Date Received: 6/8/06

Lab Work Order: 06-3650
Lab Sample ID: 06-3650-11
Sample Matrix: Wipe

METALS

Method: SW6010

Prep Method: SW6010

Date Prepared: 6/9/06
Date Analyzed: 6/13/06

Lab File ID: 061206PM
Method Blank: MB-10113

Dilution Factor: 1
Lab Fraction ID: 06-3650-11A

| Analytes | CAS Number | Result | LQL | Units |
|----------|------------|--------|-----|---------|
| Lead | 7439-92-1 | 210 | 4.0 | µg/WIPE |

MB

Analyst

WVH

Approved

Qualifiers: B - Analyte detected in the associated Method Blank, value not subtracted from result
E - Extrapolated value. Value exceeds calibration range
H - Sample analysis exceeded analytical holding time
J - Indicates an estimated value when the compound is detected, but is below the LQL
S - Spike Recovery outside accepted limits
U - Compound analyzed for but not detected
X - See case narrative
* - Value exceeded the Maximum Contamination Level (MCL), TCLP limit, or if compound is undetected, LQL exceeds MCL.

Definitions: NA - Not Applicable
LQL - Lower Quantitation Limit
Surr - Surrogate

Print Date: 6/19/06

Evergreen Analytical, Inc.

4036 Youngfield Street, Wheat Ridge, Colorado 80033-3862
(303) 425-6021

Client Sample ID: 2728-002-DWC
Client Project ID: 213001.01
Date Collected: 6/8/06
Date Received: 6/8/06

Lab Work Order: 06-3650
Lab Sample ID: 06-3650-12
Sample Matrix: Wipe

METALS

Method: SW6010

Prep Method: SW6010

Date Prepared: 6/9/06
Date Analyzed: 6/13/06

Lab File ID: 061206PM
Method Blank: MB-10113

Dilution Factor: 1
Lab Fraction ID: 06-3650-12A

| Analytes | CAS Number | Result | LQL | Units |
|----------|------------|--------|-----|---------|
| Lead | 7439-92-1 | 140 | 4.0 | µg/WIPE |

MB

Analyst

[Signature]

Approved

Qualifiers: B - Analyte detected in the associated Method Blank, value not subtracted from result
E - Extrapolated value. Value exceeds calibration range
H - Sample analysis exceeded analytical holding time
J - Indicates an estimated value when the compound is detected, but is below the LQL
S - Spike Recovery outside accepted limits
U - Compound analyzed for but not detected
X - See case narrative
* - Value exceeded the Maximum Contamination Level (MCL), TCLP limit, or if compound is undetected, LQL exceeds MCL.

Definitions: NA - Not Applicable
LQL - Lower Quantitation Limit
Surr - Surrogate

Print Date: 6/19/06

| | |
|---------------------------|---------------------------|
| Property ID: 2728 | Date: 8-18- |
| Address: 3610 HIGH STREET | Telephone #: |
| Owner: | CO Certification #: 12860 |

Plot Plan:

↑
E

~~(46+6)(22+6) - 52 × 28 = 1456~~

(22+12)(46+12) - 22(46)

1972 - 1012 = 960

-GREY WALLS
-GREY TRIM

GARAGE

46'

22'

HIGH STREET

North
South
East
West

| Exterior Walls | | | | Doors/Trim | | | |
|----------------|--------|-----------|------------|------------|------|-----------|------------|
| Material | Area | Peel/Chip | XRF (Lead) | Material | Area | Peel/Chip | XRF (Lead) |
| BRICK | 460' d | CRACK | 14.9 | | | | |
| BRICK | 460' d | - | 18.7 | | | | |
| BRICK | 220' d | CRACK | 14.3 | | | | |
| BRICK | 220' d | CRACK | 19.9 | | | | |

North
South
East
West

| Window Trim/Fascia/Soffit | | | | Patios/Decks/Porches | | | |
|---------------------------|------|-----------|------------|----------------------|------|-----------|------------|
| Material | Area | Peel/Chip | XRF (Lead) | Material | Area | Peel/Chip | XRF (Lead) |
| WOOD | 9' d | CRACK | 4.0 | | | | |
| WOOD | ' - | CRACK | 30.4 | | | | |
| CEMENT | 3' d | CRACK | 5.9 | | | | |

North
South
East
West

| Metal Trim/Gutters/Downspouts | | | | Misc Structures/Garage/Fences | | | |
|-------------------------------|------|-----------|------------|-------------------------------|------|-----------|------------|
| Material | Area | Peel/Chip | XRF (Lead) | Material | Area | Peel/Chip | XRF (Lead) |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |

August 18, 2005

LBP Assessment Results

Strata Environmental Results

[illegible]

Property ID # 2728 / 3610 high Street



West exposure of house; paint is in good condition

| | |
|---------------------------|---------------------------|
| Property ID: 2728 | Date: 8-18-05 |
| Address: 3610 HIGH STREET | Telephone #: |
| Owner: | CO Certification #: 12860 |
| Inspector/Assessor: | |

Plot Plan:

↑
E

~~$(46+12)(22+12) - 52 \times 28 = 1456$~~

$(22+12)(46+12) - 22(46)$

$1972 - 1012 = 960$

960 sq ft²

- GREY WALLS
- GREY TRIM

← N

HIGH STREET

| | Exterior Walls | | | | Doors/Trim | | | |
|-------|----------------|-------|-----------|------------|------------|------|-----------|------------|
| | Material | Area | Peel/Chip | XRF (Lead) | Material | Area | Peel/Chip | XRF (Lead) |
| North | BRICK | 460'± | CRACK | 14.9 | | | | |
| South | BRICK | 460'± | - | 18.7 | | | | |
| East | BRICK | 220'± | CRACK | 14.3 | | | | |
| West | BRICK | 220'± | CRACK | 19.9 | | | | |

| | Window Trim/Fascia/Soffit | | | | Patios/Decks/Porches | | | |
|-------|---------------------------|------|-----------|------------|----------------------|------|-----------|------------|
| | Material | Area | Peel/Chip | XRF (Lead) | Material | Area | Peel/Chip | XRF (Lead) |
| North | | | | | | | | |
| South | WOOD | 9'± | CRACK | 4.0 | | | | |
| East | WOOD | - | CRACK | 30.4 | | | | |
| West | CEMENT | 3'± | CRACK | 5.9 | | | | |

| | Metal Trim/Gutters/Downspouts | | | | Misc Structures/Garage/Fences | | | |
|-------|-------------------------------|------|-----------|------------|-------------------------------|------|-----------|------------|
| | Material | Area | Peel/Chip | XRF (Lead) | Material | Area | Peel/Chip | XRF (Lead) |
| North | | | | | | | | |
| South | | | | | | | | |
| East | | | | | | | | |
| West | | | | | | | | |

August 18, 2005

LBP Assessment Results

Strata Environmental Results

[illegible]

Property ID # 2728 / 3610 high Street



West exposure of house; paint is in good condition

25x3
lg Rock

garage

can remove
3 stumps
↑↑

clothesline
R/R

Brick
pillars

(2)
8" trees

28x6 sod

brick edging
remove

20x25 sod

3610 High Street

X Ricardo Cervantes

post

12x5
sod

house # sign
mailbox R/R

12x18 sod

water
meter

26x14 sod

tree

Property Completion Agreement

This agreement documents the completion of remedial activities performed on my property. My signature will designate that I am satisfied with the restoration of my property, and that no items are in questions, now, or at any time in the future, except those items listed below, if any.

| | |
|-------------------|------------------|
| Property ID: | 2728 |
| Property Address: | 3610 High Street |
| Owner: | Ricardo Cedantes |
| Phone: | 720-436-5799 |

Restoration Items in Question:

| |
|-------|
| Item: |
| Item: |
| Item: |
| Item: |
| Item: |
| Item: |

Additional Comments:

| |
|--|
| |
|--|

- ☒ I agree restoration is completed, except as noted
- ☐ I do not agree restoration is completed
- ☐ I agree that the sprinkler system is working properly following reinstallation by contractor

Ricardo Cedantes
Owner's Signature

Date

Jaime Rios
Contractor's Signature

Date

Consent For Access To Property

RIGHT OF ENTRY TO PREMISES

Grantor (the property owner) consents to and authorizes the United States Environmental Protection Agency (EPA) or its authorized representatives, collectively the Grantee, to enter and perform certain environmental response activities upon the following described premises:

| | |
|---|-----------------------|
| Owner's Name: Anabel & Ricardo Cervantes | Phone: |
|---|-----------------------|

| | |
|---|------------------------------|
| Addresses of Properties covered by this Agreement: | Address: 3610 High St |
| | Address: |
| | Address: |

PURPOSE OF RESPONSE ACTIVITIES

The EPA is requesting access to collect soil samples and remove soil that contains elevated concentrations of arsenic and/or lead and may pose a health hazard. The soil will be removed and the excavated area(s) will be replaced with clean materials and restored. This work is being performed under the Vasquez Boulevard/I-70 Superfund Site remediation program.

An EPA representative will contact the Grantor in-person to discuss the work to be performed. The Grantor will have an opportunity to review and approve the planned soil removal and restoration work before it begins. Once the work is finished, the Grantor will be asked to review the work and confirm that it is complete and meets with the Grantor's approval. Upon completion, the Grantor will receive written documentation from EPA that the property has been remediated.

ENVIRONMENTAL RESPONSE ACTIONS

By signing this Access Agreement, the Grantor is granting the EPA, its employees, contractors and subcontractors the right to enter the property, at all reasonable times and with prior notice, for the sole purpose of performing the work. This access shall remain in effect until the work has been satisfactorily completed. The Grantor also agrees to:

- Remove obstructions including boats, trailers, vehicles, playscape items, wood piles, dog houses, etc;
- Remove flower bulbs or plants that the Grantor or the Grantor's tenant may wish to save;
- Water and maintain replacement vegetation, including fertilizer application, as necessary subsequent to an initial watering period by EPA, unless watering is restricted by Denver Water Board;
- Abide by health and safety guidance provided by EPA;
- If the property is rented, assist EPA in obtaining tenant approval for access to the property to perform the work if EPA is unable to obtain such access; and
- Allow videotaping and/or photography of the property including exterior and interior areas of buildings.

AGREEMENT NOT TO INTERFERE

The Grantor agrees not to interfere or tamper with any of the activities or work done, or the equipment used to perform the activities, or to undertake any actions regarding the use of said property which would tend to endanger the health or welfare of the Grantees or the environment, or to allow others to use the property in such a manner.

Should you have any questions about this program, please contact the VB/I-70 Site Coordination Office at (303) 487-0377.

☐ **I grant access to my properties**

☐ **I do not grant access to my properties**

Signature

Date

Signature

Date

☐ **I would like to be present during any sampling that is required.**

☐ **My property has a working sprinkler system that will need to be replaced.**

Consentimiento para el Acceso de la Propiedad

DERECHO A ENTRAR LA PROPIEDAD

El otorgante (dueño/a de la propiedad) le da permiso y autoriza la Agencia para la Protección del Medio Ambiente de los Estados Unidos (EPA) y/o a sus representantes autorizados (Cesionario) a entrar y a llevar a cabo algunas actividades ambientales en la propiedad a continuación:

Now # (720) 436-0950

| | |
|--|---|
| Dueño/a de la Propiedad: Ricardo Cervantes Anabel & Ricardo Cervantes | Número de Teléfono: 720 4366799 |
|--|---|

| | |
|---|--------------------------------|
| Dirección de las Propiedades Cubiertas por este Acuerdo: | Dirección: 3610 High St |
| | Dirección: |
| | Dirección: |

PROPÓSITO DE LAS ACTIVIDADES AMBIENTALES

La EPA solicita el acceso a tomar muestras de tierra y a remover la tierra en su propiedad que tiene concentraciones altas de arsénico y/o plomo que podrían ser peligrosos a su salud. La tierra será removida y el(las) área(s) excavada(s) serán reemplazadas con materiales limpios. Este trabajo estará realizado abajo del Vasquez Boulevard/I-70 Superfund Site programa de remediación.

Un representante de la EPA contactará al Otorgante personalmente para discutir el trabajo que se va a realizar en la propiedad del Otorgante. El Otorgante tendrá la oportunidad de examinar y sancionar el plan de removimiento de tierra y el trabajo de restauración antes de comenzar. Cuando el trabajo se termine, el Otorgante revisará el trabajo, confirmará su terminación y cumplirá con su aprobación. Después de la terminación del trabajo, el Otorgante recibirá un documento escrito por la EPA que indicará que la propiedad ha sido remediada.

ACCIONES DE LA ACTIVIDAD AMBIENTAL

Por su firma de este Acuerdo de Acceso, el Otorgante concede el EPA, sus empleos, contratadores y subcontratadores el derecho a entrar la propiedad, en tiempos razonables y sin noticia anterior, para el único propósito a realizar el trabajo aquí descrito. Este acceso debería persistir en efecto hasta que el trabajo haya sido terminado. El Otorgante también está de acuerdo con:

- Remover obstrucciones, incluyendo botes, remolque, vehículos, juguetes de niños, montones de madera, casas de perros, etc.
- Remover bulbos de flores, u otras plantas que el Otorgante o inquilino del Otorgante quisiera guardar;
- Regar y mantener el reemplazo de vegetación, incluyendo la aplicación de fertilizante, subsecuente a la riega inicial por la EPA, a menos que el uso de agua esté restringido por la Junta de Agua de Denver.
- Seguir las recomendaciones de la guía de Salud y Seguridad de la EPA;
- Si la propiedad es rentada, asistir a la EPA a obtener la aprobación del inquilino para tener acceso a la propiedad donde se va a llevar a cabo el trabajo, si acaso la EPA no logra obtener acceso; y
- Permitir a hacer un video y/o tomar fotos de la propiedad, incluyendo el área exterior y interior del edificio.

ACUERDO A NO INTERFERIR

El Otorgante está de acuerdo a no interferir o meterse en cualquier actividad o trabajo hecho, o equipo que va a llevar a cabo las actividades en la propiedad, o arriesgar la salud o bienestar de los Cesionarios o el medio ambiente, o permitir otras personas a usar la propiedad en alguna manera.

Si tiene preguntas sobre este programa, por favor llame a la oficina de VB/I-70 a (303) 487-0377.

☒ Si, yo permito acceso a mi propiedad.

☐ No permito acceso a mi propiedad.

Ricardo Cervantes

Firma

Fecha

Firma

Fecha

☐ Me gustaría ser presente durante de cualquier colección de muestras.

☐ Mi propiedad tiene un sistema de regar plantas y sacate (sprinkler system).



Project Resources Inc.

Property Access Checklist

| | | |
|---------------------------------|---|-----------------|
| Property ID: 2728 | <input type="checkbox"/> WORK STARTED | ON: ___/___/___ |
| Property Address: 3610 high st. | <input type="checkbox"/> WORK COMPELTED | ON: ___/___/___ |

| | |
|---|--|
| Property Owner: Ricardo Valenzuela | Property Renter: |
| Mailing Address: 3610 high street Denver Colorado 80205 | Home Phone: |
| Home Phone: 720 - 436 - 6799 | Fax: |
| Fax: | Cell/Pager: |
| Cell/Pager: | Additional Information: NO SPRINKLER SYSTEM |

| | | |
|--|---------------------|------------------------|
| <input checked="" type="checkbox"/> Notification Letter | Sent: 03/01/05 | By: M. Redfern |
| <input checked="" type="checkbox"/> Access Agreement | Signed: 03/09/05 | By: Ricardo Cervantes |
| <input checked="" type="checkbox"/> Restoration Agreement | Signed: 03/16/05 | By: Ricardo Cervantes |
| <input type="checkbox"/> Topsoil Sampling (if applicable) | ___/___/___ | By: |
| <input type="checkbox"/> Disposal Sampling (if applicable) | ___/___/___ | By: |
| <input type="checkbox"/> Garden Sampling (if applicable) | ___/___/___ | By: |
| <input type="checkbox"/> Utility Clearance | Called: ___/___/___ | By: |
| <input checked="" type="checkbox"/> Video/Photos (Before) | On: 03/16/05 | By: M. Fowler N. Reyes |
| <input type="checkbox"/> Video/Photos (During) | On: ___/___/___ | By: |
| <input type="checkbox"/> Video/Photos (After) | On: ___/___/___ | By: |
| <input type="checkbox"/> Video/Photos (30-Day) | On: ___/___/___ | By: |
| <input type="checkbox"/> Property Completion Agreement | Signed: ___/___/___ | By: |
| <input type="checkbox"/> Final Report | Issued: ___/___/___ | By: |

Air Monitoring (as applicable)

| | | |
|--|-----------------|-----|
| <input type="checkbox"/> Community <input type="checkbox"/> Crew | On: ___/___/___ | By: |
| Results: | | |
| <input type="checkbox"/> Community <input type="checkbox"/> Crew | On: ___/___/___ | By: |
| Results: | | |
| <input type="checkbox"/> Community <input type="checkbox"/> Crew | On: ___/___/___ | By: |
| Results: | | |



Project Resources Inc.

Restoration Agreement

The purpose of this agreement is to provide a mutual agreement as to conditions of property prior to remediation activities. This will also serve as decontamination for the purpose of assuring that restoration activities are completed to the satisfaction of the property owner and the United States Environmental Protection Agency (EPA).

| | |
|-------------------|-------------------|
| Property ID: | 2728 |
| Property Address: | 3610 High Street |
| Owner: | Ricardo Cervantes |
| Phone: | 720-436-6799 |

On the attached diagram(s) indicate area(s) to excavated and depth of excavation, location of all known utilities, subsurface features, surface structures and landscaping features, access location(s) to be used by contractor, and the direction of North. Indicate distances, depths, material types, etc. Indicate digital photos by referencing the photo-log number with an arrow indicating direction of view.

Items To Be Removed By Owner Before Start Of Remediation: (Use additional sheets as necessary)

The removal, storage, disposal, and/or return of these items is the Owner's responsibility.

| | |
|-------|-------------|
| Item: | truck fence |
| Item: | |
| Item: | |
| Item: | |
| Item: | |
| Item: | |
| Item: | |



Project Resources Inc.

Items To Be Removed By Contractor During Remediation And Not Replaced
(Use additional sheets as necessary)

| | |
|-------|-----|
| Item: | N/A |
| Item: | |
| Item: | |
| Item: | |
| Item: | |
| Item: | |
| Item: | |

Items To Be Removed By Contractor During Remediation And Replaced
(Use additional sheets as necessary)

| | |
|-------|---|
| Item: | Mailbox House # sign front yard fence/Clothesline |
| Item: | |
| Item: | |
| Item: | |
| Item: | |
| Item: | |



Landscape Inventory
(Use additional sheets as necessary)

| Item | Quantity | Unit | Description/Explanation |
|--|---|-------------|---|
| Total Area Of Property To Be Excavated | 1388 | Square Feet | |
| Number of trees > 2 inch trunk diameter | 3 | | |
| Number of trees < 2 inch trunk diameter | 0 | | |
| Number of Sprinkler Zones, Control Valves, Timers, Heads, etc. Attach a sketch of the sprinkler layout. | N/A | | Zones: _____ Heads: _____ Control Valves: _____ |
| Number of and total size of all gardens / flower beds. Attach a sketch of relative sizes and locations. | # Of Beds: _____ # Of Gardens: _____ | | Ft ² Of Beds: _____ Ft ² Of Gardens: _____ |



| Item | Quantity | Unit | Description/Explanation |
|--|--|------|--|
| <p>Agreed upon value of plant materials <u>not to be replaced</u> by contractor.</p> <p>Note this value will be used to issue a plant voucher to the property owner.</p> | Total # Of Beds: _____ | \$ | <p>Total Ft² Of Beds To Be Replaced With Certificate:</p> <p>_____ <u>N/A</u> _____</p> |
| <p>Agreed upon list of plant materials that will be replaced by contractor. Be very specific and detailed.</p> <p>Include a sketch of where each plant will be placed by the contractor.</p> | <u>N/A</u> | Each | Only Use For Plants That Are Being Saved and Re-planted |
| <p>Agreed upon area of property to be replaced with grass sod.</p> <p>Include a sketch of the area(s) to be replaced with grass sod.</p> | <u>1313</u> | SF | Total Ft ² Of Sod To Be Laid: <u>1313</u> |
| <p>Area of City or County property to be landscaped per their requirements.</p> <p>Include a sketch of the area (s)</p> | <p>Total Ft²:</p> <p><u>364</u></p> | SF | <p>Sod: <u>364</u></p> <p>Brown Mulch: _____</p> <p>Red Mulch: _____</p> |
| <p>Agreed upon area of property to be replaced with mulch.</p> | Total Ft ² Of Mulch: _____ | SF | <p>Red: _____</p> <p>Brown: _____</p> |



Project Resources Inc.

| Item | Quantity | Unit | Description/Explanation |
|--|---|------|---|
| Agreed upon area to be replaced rock. | Total Ft ² Of Rock: <u>75</u> | SF | Large: <u>75</u> Medium: <u>-</u> Small (pea gravel): <u>-</u> Driveway Gravel: <u>-</u> |
| Agreed upon area to be replaced with no groundcover. | Total Ft ² With No Groundcover: <u>NA</u> | | |

Additional Comments / Instructions:



Project Resources Inc.

Additional Comments / Instructions Continued:

N/A ☐ Check the box if Owner does not want PRI to document interior foundation walls and possible pre-existing damage. By checking this box PRI is not responsible for any damage done to the interior of house, including foundation cracks or fissures.

☒ I agree

☐ I do not agree

☒ I agree

☐ I do not agree

3/16/05
Ricardo Cervantes
Owner's Signature Date

Jaime Reyes 3/16/05
Contractor's Signature Date

Property ID:

2728

Remarks:

NO SPRINKLER SYSTEM

Address 1:

3610 HIGH STREET

Address 2:

City:

DENVER

State:


CO

Zip:

80205

| Date | Item | Quantity | Unit | Remarks |
|-----------|---------------------------|----------|------|---------|
| 16-Mar-05 | Excavated Area (Estimate) | 1388 | SF | |
| 16-Mar-05 | City Property Area | 364 | SF | |
| 16-Mar-05 | Large Rock (Estimate) | 75 | SF | |
| 16-Mar-05 | Sod (Estimate) | 1313 | SF | |

Ricardo Cervantes
3610 High St
Denver CO 80205

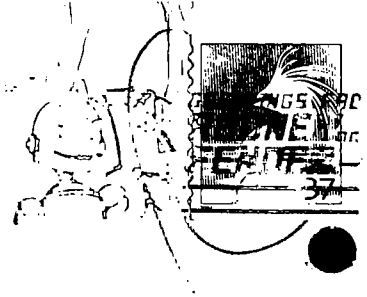

VB/I-70 Site Coordination
10 E. 55th Avenue
Denver, CO 80216

80216+1769



Meagan Redfern

#2728

From: OCARS_Pro@uncc.org
Sent: Wednesday, May 18, 2005 1:46 PM
To: Meagan Redfern
Subject: UNCC EMLCFM 2005/05/18 #00323 B0040774-00B NORM NEW

EMLCFM 00323 UNCCb 05/18/05 01:46 PM B0040774-00B NORM NEW STRT LREQ

Ticket Nbr: B0040774-00B
Original Call Date: 05/18/05 Time: 01:46 PM Op: MRE
Locate By Date : 05/20/05 Time: 11:59 PM Meet: N Extended job: N
State: CO County: DENVER City:
Addr: 3610 Street: HIGH ST
Grids: 03S068W26NE : : Legal: N
Lat/Long: 39.768790/-104.965593 39.768790/-104.963802
: 39.766264/-104.965593 39.766264/-104.963802
Type of Work: SOIL EXCAVATION Exp.: N
Boring: N
Location: LOC ENTIRE LOT*TO INCLUDE ALL EASEMENTS AND CITY PROPERTY
Company : PROJECT RESOURCES INC. Type: OTHR
Caller : MEAGAN REDFERN Phone: (303)487-0377
Alt Cont: AMY JAMES Phone: (303)487-0377
Fax: Email: MREDFERN@PROJECTRESOURCESINC.COM
Done for: EPA/ARMY CORPS OF ENGINEERS
Remarks:

Members 360NT3 = 360 NETWORK-TOUCH AMERICA CMSND00= COMCAST - NORTH
DENVER
Members PCNDU0 = XCEL ENERGY-NORTH DENVER PSND14 = XCEL ENGY--APPT
SCHEDULE-- U
Members QLNCND0= QWEST LOCAL NETWORK (UQ) QLNCND1= QWEST LOCAL
NETWORK
Members WCG01 = WILTEL COMMUNICATION
You are responsible for contacting any other utilities that are not
listed above
including the following tier 2 members not notified by the center:
DNVH20 DENVER WATER DEPT (303)628-6666
DNVPR1 DENVER PARKS & REC. (303)458-4839
DTEO01 DNVR TRAFFIC ENG OPERAT. (720)865-4001
WWMG01 WASTEWATER MGMT DIVISION (303)446-3744

lr

$$25 \times 3 = 75$$

rod

$$20 \times 25 = 500$$

~~$$28 \times 6$$~~

$$4 \times 1 = 4$$

$$12 \times 5 = 60$$

$$12 \times 18 = 216$$

$$26 \times 14 = 364$$

$$1 \times 1 = 1$$

$$28 \times 6 = 168$$

$$1313$$

city

$$26 \times 14 = 364$$

$$\text{TOTAL} = 1388$$